

EXHIBIT L

BEST AVAILABLE COPY

Anchor Tiedown Systems, Inc.

205 Camino Alto #135
P.O. Box 2517
Mill Valley, CA 94941

(415) 389-0576
Fax (415) 389-0578



FACSIMILE COVER SHEET

DATE: 8.20.98

TIME: 2:00

TOTAL PAGES (Inc. this page): 6

TO:

BRIAN FISHER AT RMJ

FAX #: 650-871-2459

PHONE #: 650-871-2282

SUBJECT: SHERATON INN • S. SAN FRANCISCO


MESSAGE: FROM YOUR LOAD TABLE I HAVE
PREPARED THE FOLLOWING PRELIMS

- 1 PG TITLE
- 2 PGS PROPOSED SHOP DWGS
- 2 PGS CALCS FOR ABOVE

BY: ARTHUR RICHARDSON

Calculations Table

PROJECT NAME SHRUTI INN

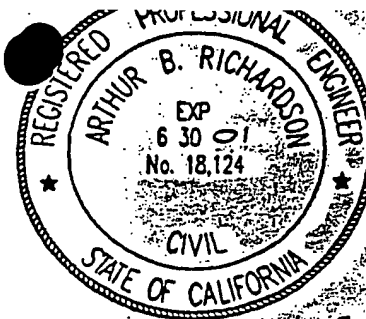

8.20.98


[illegible]

S. SAN FRANCISCO

Calculations Table

PROJECT NO. 98122

PROJECT NAME SHERATON INN

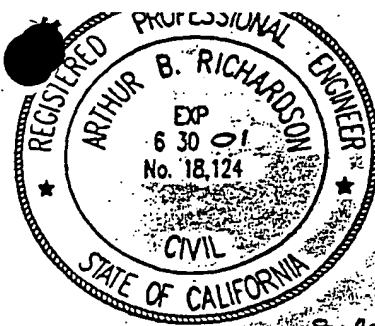

8.20.98

LEVEL	TDS MODEL	TDS VALUE	TDS ROD	Σ TDS ↓ VAL	FRAME VALUE	CONTR VALUE	HD VALUE	HD	
4TH	2x3B	11.26							(DBL 3)
	2x24		10.46			10.46	8.00		
	2-3x4				12.57				
3RD	2x2A	12.20		22.66					
	2x25		16.36			16.36	16.00		
	2x4x4				16.95				
2ND	2x2B	14.10		30.46		30.46			
	2x27		32.06				25.00		
	2-3x4				31.71				
1ST	2x2D	14.10		44.56					
	2x28		41.88				33.50		
	8x4+10x4				36.09	36.09			
4TH	3D	10.35							
	25		8.18			8.18	3.50		
	2-2x4				8.20				
3RD	2A	6.10		14.28		14.28			
	27		16.03				10.50		
	4-2x4				14.76				
2ND	2D	9.17		23.45		23.45			
	29		26.50				20.00		
	4-3x4				23.51				
1ST	2D	9.17		32.62					
	26		32.72				31.00		
	2-3x4				31.71	31.71			
4TH	3B	5.63							
	24		5.23			5.23	2.90		
	2-2x4				8.20				
3RD	2A	6.10		11.33					
	25		8.18			8.18	8.00		
	2-2x4				8.20				
2ND	2D	7.05		15.23		15.23			
	27		16.03				13.00		
	3-3x4				18.04				
1ST	2D	7.05		22.28					
	28		20.94			20.94	18.5		
	4-3x4				23.51				
3RD	3B	5.63							
	24		5.23			5.23	2.50		
	2-2x4				8.20				
2ND	2A	6.10		11.33					
	25		8.18			8.18	7.50		
	2-3x4				12.57				
1ST	2D	7.05		15.23		15.23			
	27		16.03				13.60		
	4-3x4				23.51				

DBL [352A2B2B
(4578)

3D2A2D2D (57910)

3A2A2A2A (4578)

3A2A2A (457)

Level 3 (R) 5230 #

Level 2 (R) 8180 #

Level 1 (L) 15230 #

TDS 3B
 2 -2x STUDS TYP.
 TDS R4
 3 1/2" MAX
 TDS C54
 EXPANSION WASHER
 (2.5k)
 TDS 2A
 SOLID BLOCKING TYP.
 2-3x4 STUDS TYP.
 2 ROWS SHEAR WALL EDGE NAIL'G TYP.
 TDS R5
 6" MAX.
 TDS 2B
 EXPANSION WASHER
 (7.5k)
 SOLID BLOCKING TYP.
 6" MAX.
 4 -3x STUDS TYP.
 2 ROWS SHEAR WALL EDGE NAILING STAGGER
 TDS R7
 (13.6k)
 TDS COUPLER
 A.B. BY OTHERS
 A.B.'S PER STRUCTURAL DWGS. TYP.
 3B 2A 2B (457)

4

Level 3 (R) 8180 #

Level 2 (ST) 12570 #

Level 1 (R) 20940 #

TDS 3D
 2 -2x STUDS TYP.
 TDS R5
 3 1/2" MAX
 TDS C75
 EXPANSION WASHER
 (5.0k)
 TDS 2A
 SOLID BLOCKING TYP.
 2 ROWS SHEAR WALL EDGE NAIL'G TYP.
 2-3x STUDS TYP.
 TDS R7
 6" MAX.
 TDS 2C
 EXPANSION WASHER
 (12.5k)
 SOLID BLOCKING TYP.
 6" MAX.
 4 -3x STUDS TYP.
 2 ROWS SHEAR WALL EDGE NAILING STAGGER
 TDS R8
 (20.5k)
 TDS COUPLER
 A.B. BY OTHERS
 A.B.'S PER STRUCTURAL DWGS. TYP.
 3D 2A 2C (578)

5

Level 2 (R) #

Level 1 (R) 5230 #

TDS 3B
 2 -2x STUDS TYP.
 TDS R4
 3 1/2" MAX
 2 ROWS SHEAR WALL EDGE NAIL'G TYP.
 TDS C44
 EXPANSION WASHER
 (1.5k)
 TDS 2A
 SOLID BLOCKING TYP.
 2 ROWS SHEAR WALL EDGE NAIL'G TYP.
 6" MAX.
 2-3x STUDS TYP.
 TDS R4
 (4.2k)
 TDS COUPLER
 A.B. BY OTHERS
 A.B.'S PER STRUCTURAL DWGS.
 3B 2A (44)


6

Level 1 (R) 5230 #

TDS 3B
 2 ROWS SHEAR WALL EDGE NAILING TYP.
 3 1/2" MAX.
 2-2x STUDS TYP.
 TDS R4
 (1.2k)
 TDS COUPLER
 A.B. BY OTHERS
 A.B.'S PER STRUCTURAL DWGS.
 3B (4)

7


Level 4 (RODS) 10'
 Level 3 (RODS) 163'
 Level 2 (I) 30460 #
 Level 1 (STUDS) 36090 #

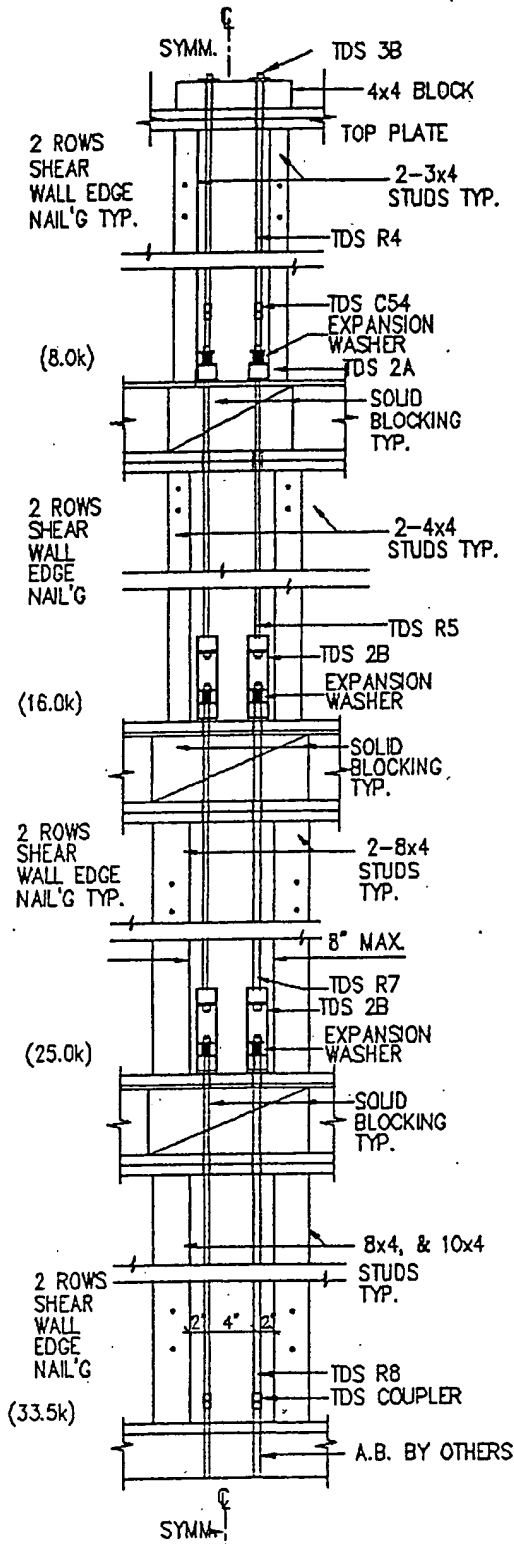

3B 2A 2B 2B (4578) 3B 2A 2B 2B (4578)

1

Level 4 (R) 8'
 Level 3 (I) #
 Level 2 (I) 23450 #
 Level 1 (ST) 31710 #

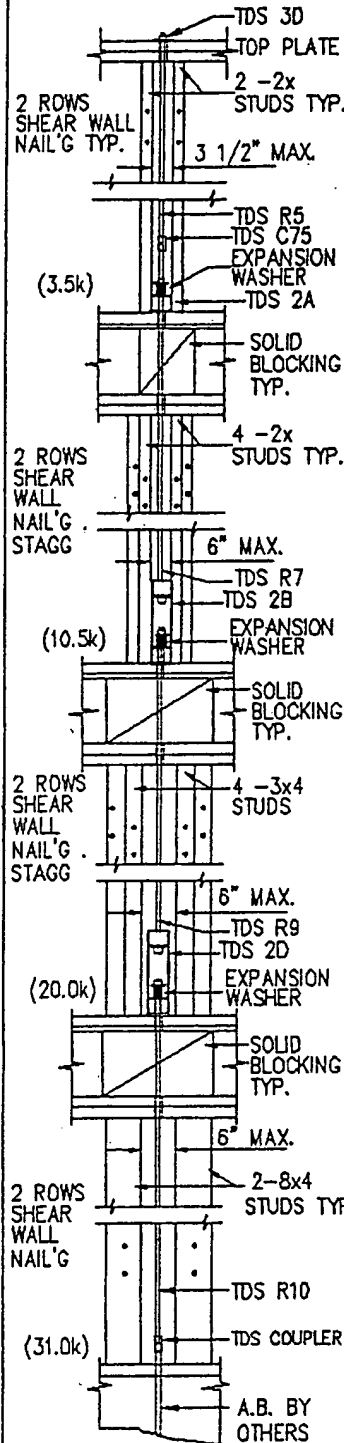


A.B.'S PER STRUCTURAL DWGS.

3D 2A 2D 2D (5,7,9,10)

2

Level 4 (R) 5230 #
 Level 3 (R) 8180 #
 Level 2 (I) 15230 #
 Level 1 (R) 20940 #

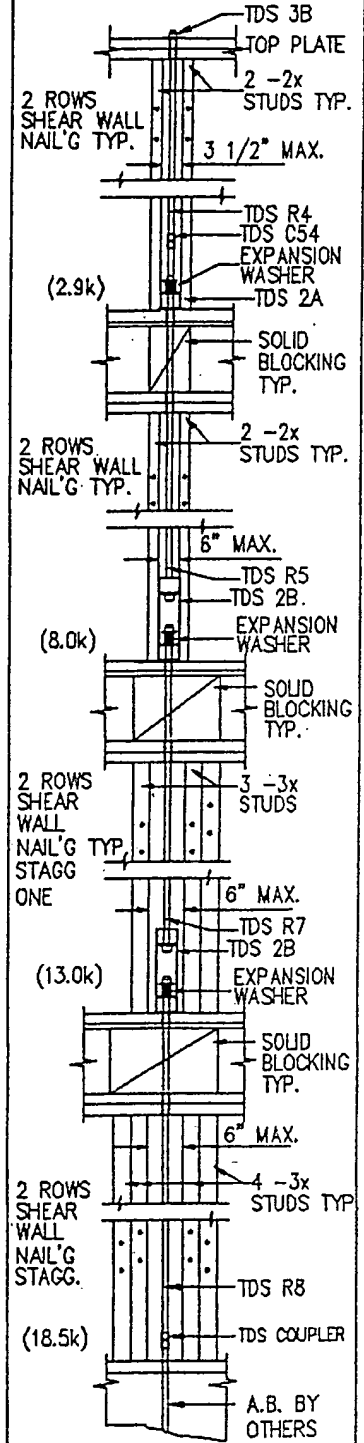

A.B.'S PER STRUCTURAL DWGS.

3B 2A 2B 2B (4578)

3

SHERATON INN

SOUTH SAN FRANCISCO, CALIFORNIA

MBR JOB #98122

**This Page is Inserted by IFW Indexing and Scanning
Operations and is not part of the Official Record**

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked:

- ☐ BLACK BORDERS
- ☐ IMAGE CUT OFF AT TOP, BOTTOM OR SIDES
- ☒ FADED TEXT OR DRAWING
- ☒ BLURRED OR ILLEGIBLE TEXT OR DRAWING
- ☐ SKEWED/SLANTED IMAGES
- ☐ COLOR OR BLACK AND WHITE PHOTOGRAPHS
- ☐ GRAY SCALE DOCUMENTS
- ☐ LINES OR MARKS ON ORIGINAL DOCUMENT
- ☐ REFERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY
- ☐ OTHER: _____

IMAGES ARE BEST AVAILABLE COPY.

As rescanning these documents will not correct the image problems checked, please do not report these problems to the IFW Image Problem Mailbox.